

# SEALEY

## 13-FUNCTION PROFESSIONAL SMART AUTO-SCANNING DIGITAL MULTIMETER

MODEL NO: **MM22.V2**

Thank you for purchasing a Sealey product. Manufactured to a high standard, this product will, if used according to these instructions, and properly maintained, give you years of trouble free performance.

**IMPORTANT:** PLEASE READ THESE INSTRUCTIONS CAREFULLY. NOTE THE SAFE OPERATIONAL REQUIREMENTS, WARNINGS & CAUTIONS. USE THE PRODUCT CORRECTLY AND WITH CARE FOR THE PURPOSE FOR WHICH IT IS INTENDED. FAILURE TO DO SO MAY CAUSE DAMAGE AND/OR PERSONAL INJURY AND WILL INVALIDATE THE WARRANTY. KEEP THESE INSTRUCTIONS SAFE FOR FUTURE USE.



Refer to instructions



Electrical shock hazard



Warning



Keep in dry area protect from rain

### 1. SAFETY

#### 1.1. GENERAL SAFETY

- ✓ Perform a risk assessment of tasks to be carried out before using the meter.
- ✓ Measurement category III is for the measurements performed on circuits directly connected to the low voltage installation. This meter has been designed according to IEC-61010-1 concerning electronic measuring instruments with an overvoltage category (CAT III 600V) and pollution degree 2.
- ✓ Please ensure that these guidelines are followed to guarantee the optimal performance and safety of our meter and the user.
- ✓ Follow all safety and operating instructions to ensure the meter is used safely and is kept in good condition. With proper use and care, your digital multimeter will give you years of satisfactory service.
- ✓ When using this multimeter, please observe all normal safety rules concerning protection against the dangers of electrical current, and protection of the meter against misuse.
- ✓ Full compliance with safety standards can only be guaranteed if used with the test leads supplied. If necessary, they must be replaced with genuine Sealey leads and/or those with the same electrical ratings. Failure to do so will invalidate the warranty.
- ✓ Only use accessories that meet the manufacturers specification.
- \* **DO NOT** use leads if damaged or if the wires are bared in any way.

#### 1.2. DURING USE

- \* **NEVER** exceed the protection limit indicated in the specifications for each range of measurement.
  - \* **NEVER** use the meter to measure voltages that might exceed 600V above earth ground in category III installations.
  - ✓ Always be careful when working with voltages above 60V dc or 30V ac rms. Keep fingers behind the probe barriers while measuring.
  - \* **DO NOT** perform resistance measurements on live circuits.
  - ✓ Inspect test leads and probes for cracks, breaks or crazes in the insulation before using the meter.
  - ✓ Familiarise yourself with the application and limitations of the multimeter as well as the potential hazards.
  - ✓ This meter is designed to be used outdoors in dry conditions in accordance with Overvoltage Category III and Pollution Degree 2
- IF IN ANY DOUBT CONSULT A QUALIFIED ELECTRICIAN.**
- **WARNING! USE EXTREME CAUTION WHEN WORKING WITH HIGH VOLTAGES.**
  - \* **DO NOT** position the equipment so it is difficult to disconnect the probes.
  - ✓ When the meter is connected to a circuit, **DO NOT** touch unused meter terminals.
  - ✓ When the magnitude of the value to be measured is unknown, set the range selector to the highest value available.
  - ✓ Before commencing testing, follow instructions below and select the correct input sockets, function and range on the multimeter.
  - ✓ Before changing functions, disconnect the test leads from the circuit under test.
  - ✓ Take care when working with voltages above 35V DC or 25V AC rms. These voltages are considered a shock hazard.
  - ✓ Keep fingers behind the probe barriers whilst measuring.
  - \* **DO NOT** test voltages above 600V - the circuitry of the multimeter may be destroyed.
  - **WARNING! NEVER** connect the multimeter to a voltage source / live circuit when the rotary switch is set to any other function apart from voltage testing.
  - **WARNING! NEVER** perform resistance, transistor, diode or continuity measurements on live circuits.
  - ✓ Always discharge filter capacitors in power supplies and disconnect the power when making resistance or diode tests.
  - **WARNING!** Voltage checks on electrical outlets can be difficult and misleading because of the uncertainty of connection to the recessed electrical contacts. Other means should be used to ensure that the terminals are not "live".
  - \* **DO NOT** use the multimeter in a potentially explosive atmosphere.
  - \* **DO NOT** operate the meter unless the back cover and the battery and fuse doors are in place and fastened securely.
  - ✓ If any abnormal readings are observed, the multimeter must be checked out by an authorised technician.
  - ✓ When not in use, store the multimeter carefully in a safe, dry, childproof location out of direct sunlight. Storage temperature range is -10 to 60°C (14°F to 140°F)
  - ✓ Always turn off the power and disconnect the test leads before opening the doors to replace the fuse or batteries.
  - ✓ The user shall ensure that test probes are correctly selected in order to prevent danger. Probes shall be selected to ensure that adequate barriers guard against inadvertent hand contact with live conductors under test and that probes have minimal exposed probe tips. Where there is a risk of the probe tip short circuiting with other live conductors under test, it is recommended that the exposed tip length shall not exceed 4mm.
- NOTE:** The warnings, cautions and instructions referred to in this manual cannot cover all possible conditions and situations that may occur. It must be understood that common sense and caution are factors which cannot be built into this product, but must be applied by the operator.

### 1.3. MAINTENANCE SAFETY

- ✓ Before opening case, always disconnect test leads from all energized circuits.
- ✓ For continuous protection against fire, replace fuse only with ratings: F 10A /600V Ø6x30 (Quick Acting)
- ✗ **NEVER** use the meter unless the back cover is closed completely.
- ✗ **DO NOT** use abrasives or solvents on the meter. To clean it use only a damp cloth and mild detergent.

### 1.4. PROBE ASSEMBLY OPERATION

- ✓ Probe assemblies are to be used for mains measurements and shall have a voltage rating to at least the voltage of the circuit to be measured.
- ✓ If the probe assembly is used in a manner not specified by the manufacturer, the protection provided by the probe assembly may be impaired.
- ✓ The applicable measurement category of a combination of a probe assembly and an accessory is the lower of the measurement categories of the probe assembly and of the accessory.
- ✓ Inspect the probes for damage to ensure safe use.

## 2. INTRODUCTION

High-precision Smart auto-scanning multimeter. The intelligent multimeter automatically detects and selects the required test function, AC/DC, voltage/current, resistance and continuity. Confirms to EN 61010-1 CATIII 600V safety requirements for electrical equipment for measurement, control and laboratory use. Features temperature measurement capability, data hold and auto-power-off function. Non-contact voltage detection (NCVD) enables one-handed use. The live test feature can test for live feeds with a single probe. Supplied with probes including a thermocouple probe and integral upright stand for use on the workbench. Clear and easy-to-read LCD display.

## 3. SPECIFICATION

Accuracy is specified for one year after calibration, at operating temperatures of 18°C to 28°C, with relative humidity at 0% to 75%. Accuracy specifications take the form of:  $\pm(\% \text{ of Reading} + \text{Number of Least Significant Digits})$

### 3.1. VOLTAGE

FUNCTION	RANGE	RESOLUTION	ACCURACY
DC Voltage V $\overline{\text{---}}$	4.000V	1mV	$\pm(0.5\% \text{ of rdg} + 3 \text{ Digits})$
	40.00V	10mV	
	400.0V	100mV	
	600V	1V	
AC Voltage <sup>1,2</sup> V $\sim$	4.000V	1mV	$\pm(1.0\% \text{ of rdg} + 6 \text{ digits})$
	40.00V	10mV	$\pm(1.0\% \text{ of rdg} + 3 \text{ digits})$
	400.0V	100mV	
	600V	1V	

1. Frequency Range: 40Hz to 1kHz RMS.  
2. AC minimum measurement: 5% of lowest range;  
3. Overload Protection: 600V dc or 600V ac rms.



When the testing environment is below CAT III, the meter can meet the range of 50-1000V for non-contact voltage detect and 100-1000V for LIVE test. In both cases they are not connecting ground or neutral.

### 3.2. NON-CONTACT VOLTAGE DETECT

VOLTAGE	FREQUENCY	INDICATION
50 to 1000V	50Hz to 400Hz	4Bars display/ Alarm light/Beep

### 3.3. LIVE TEST

VOLTAGE	FREQUENCY	INDICATION
100 to 1000V	50Hz to 400Hz	"H" display/ Alarm light/Beep

### 3.4. TEMPERATURE MEASUREMENT (K-TYPE THERMOCOUPLE)

RANGE	RESOLUTION	ACCURACY
-200 to 1200°C	1°C	$\pm(2\% \text{ of rdg} + 3 \text{ digits})$
-328 to 2192°F	1°F	$\pm(2\% \text{ of rdg} + 6 \text{ digits})$

### 3.5. CURRENT

FUNCTION	RANGE	RESOLUTION	ACCURACY
DC Current mA $\overline{\text{---}}$	4000mA	1mA	$\pm(1\% \text{ of rdg} + 3 \text{ digits})$
	10.00A	10mA	$\pm(1.5\% \text{ of rdg} + 3 \text{ digits})$
AC Current mA $\sim$	4000mA	1mA	$\pm(1.5\% \text{ of rdg} + 3 \text{ digits})$
	10.00A	10mA	$\pm(2\% \text{ of rdg} + 3 \text{ digits})$

**Overload protection:**  
 10A range: Maximum input 10A DC or AC RMS. F 10A/600V fuse.  
 Over Load indication: OL Displayed.  
 >1A for 1min load on then 10min load off.  
 Ensure terminal sockets have a good connection.

### 3.6. RESISTANCE

FUNCTION	RANGE	RESOLUTION	ACCURACY
Resistance $\Omega$	400.0 $\Omega$	0.1 $\Omega$	$\pm(0.5\%$ of rdg+3 digits)
	4.000k $\Omega$	1 $\Omega$	$\pm(0.5\%$ of rdg+2 digits)
	40.00k $\Omega$	10 $\Omega$	
	400.0k $\Omega$	100 $\Omega$	
	4.000M $\Omega$	1k $\Omega$	
	40.00M $\Omega$	10k $\Omega$	$\pm(1.5\%$ of rdg+3 digits)
Overload protection: 600V DC or 600V AC rms.			

### 3.7. CONTINUITY CHECK

FUNCTION	RANGE	RESOLUTION	DESCRIPTION
Continuity Test 	200.0 $\Omega$	0.1 $\Omega$	Continuity beeper $\leq 50\Omega$
Overload protection: 600V AC or 600V DC rms. Test Condition: Open circuit voltage: approx. 0.5V			

### 3.8. DIODE TEST

FUNCTION	RANGE	RESOLUTION	ACCURACY
Diode Test 	1.000 V	0.001V	1.0% uncertainty
Overload protection: 600V DC or 600V AC rms. Test Condition: Forward DC current approximately 1mA. Reversed DC voltage approximately 1.5V			

### 3.9. CAPACITANCE

FUNCTION	RANGE	RESOLUTION	ACCURACY
Capacitance 	4.000nF	1pF	$\pm(5.0\%$ of rdg+30 digits)
	40.00nF	10pF	$\pm(3.0\%$ of rdg+5 digits)
	400.0nF	0.1nF	
	4.000 $\mu$ F	1nF	
	40.00 $\mu$ F	10nF	
	400.0 $\mu$ F	0.1 $\mu$ F	
	1.000mF	1 $\mu$ F	
Overload protection: 600V DC or 600V AC rms. (Auto range only.)			

### 3.10. LINEAR FREQUENCY

RANGE	RESOLUTION	ACCURACY
10.00 to 40.00Hz	0.01Hz	$\pm(0.5\%$ of rdg+3 digits)
40.0 to 400.0Hz	0.1Hz	
400 to 4000Hz	1Hz	
Overload protection: 600V DC or 600V AC rms. Cannot accept below 10Hz and Over 1KHz.		

### 3.11. SCAN SMART MEASURE MODE RANGE

FUNCTION	RANGE
DC Voltage	0.700V to 600.0V
AC Voltage	0.700V to 600.0V
Resistance	50.0Ω to 40.00MΩ
Continuity	0.0 to 50.0Ω
DC Current	1mA to 10.00A
AC Current	4mA to 10.00A
Please check accuracy at above function tables.	

### 3.12. GENERAL SPECIFICATIONS

AC Voltage (Accuracy):	4V/40V/400V/600V	Relative Humidity:	(1) Operating: <80% RH, non-condensing (2) Storage: <80% RH, battery removed
DC Voltage (Accuracy):	4V/40V/400V/600V	Overvoltage Category:	CAT III 600V
AC Current (Accuracy):	4000mA/10.00A	Replaceable Fuse Rating & Capacity:	F 10A/600V, Φ6×30mm (fast-acting)
DC Current (Accuracy):	4000mA/10.00A		
Resistance (Accuracy):	400Ω/4kΩ/40kΩ/400kΩ/4MΩ/40MΩ		
Auto Range:	ACV/DCV/Resistance/Continuity/Diode/Temperature/Capacitance/NCV/LIVE/mA/A		
Auto Scan:	V/R/CONT/A		
Capacitance (Accuracy):	4.000nF~4mF		
Temperature (Accuracy):	-200°C to 1200°C /-328°F to 2192°F		
Frequency (Accuracy):	Yes		
Duty Cycle:	No		
Continuity:	Yes		
Diode Test:	Yes		
Backlit/Torch:	Yes		
Transistor Test:	No		
Digits x Height:	4 x 16mm		
Low Battery Indicator:	Yes		
Battery (Supplied):	2 x 1.5V (AAA)		
Information:	Data-Hold, Auto-Power-Off, Integral Stand & Live Test.		
Size (L x W x D):	130 x 62 x 26mm		
Conformity:	EN 61010-1		

Probe Specification	
Voltage	600V
Measurement Category	Category III

Probe Symbols			
	Hazardous voltage		Caution - Read Instructions
	Conforms to standard		Double Insulated

## 4. OPERATION

**DO NOT** position the equipment so that it is difficult to operate the disconnecting device.

### 4.1. SCAN (SMART) MEASUREMENT MODE

Select SCAN using the FUNC. Key. Connect the black lead and red test leads plug to the COM and V terminals. **NOTE:** when measuring current, the red test lead must plug into the mA/A terminal. Connect the test leads probe to the target. The device will select the mode according to the target (AC or DC Voltage/Resistor/Continuity/AC or DC Current).

### 4.2. DC VOLTAGE

Select DCV using the FUNC. Key. Connect the black and red test leads plug to the COM and V terminal. Connect the test leads probe to the target. Read the displayed value. **NOTE:** the reading will display negative if the probes are connected the wrong way around.

### 4.3. AC VOLTAGE

Select ACV using the FUNC. Key. Connect the black and red test leads plug to the COM and V terminal.

Connect the test leads probe to the target. Read the displayed value.

#### 4.4. RESISTANCE MEASUREMENT

Select Resistance using the FUNC. Key. Connect the black and red test leads plug to the COM and V terminal. Connect the test leads probe to the target. Read the displayed value. **DO NOT** input a Voltage source at this mode.

#### 4.5. AUDIBLE CONTINUITY TEST

Select Continuity (🔊) using the FUNC. Key. Connect the black and red test leads plug to the COM and V terminal. Connect the test leads probe to the target. The meter will show the resistance of the connection. When the circuit is below 50Ω, a continuous beep will sound. **DO NOT** input a Voltage source at this mode.

#### 4.6. CURRENT MEASUREMENT

Turn off power to the circuit. Discharge all high voltage capacitors. Connect the black and red test leads to the COM and mA/A terminal. Use the FUNC. Key to select DCA or ACA measure mode. Break the circuit path to be tested. Touch the black probe to the negative side of the break; touch the red probe to the positive side of the break. **NOTE:** reversing the leads will give a negative reading, but will not damage the multimeter. Turn on power to the circuit; then read the display. Turn off power to the circuit and discharge all high voltage capacitors. Remove the Meter and restore the circuit to normal operation.

#### 4.7. CAPACITANCE MEASUREMENT

Use the FUNC. Key to select Capacitance measure mode. Connect the black and red test leads plug to the **COM** and **V** terminal. Connect the test leads probe to the target. Read the displayed value. Discharge all high voltage capacitors before measure. **DO NOT** input a voltage source at this mode.

#### 4.8. FREQUENCY MEASUREMENT

Use the FUNC. Key can select Frequency measure mode. Connect the black and red test leads plug to the COM and V terminal. Connect the test leads probe to the target. Read the displayed value.

#### 4.9. TEMPERATURE MEASUREMENT

Use the FUNC. Key to select Temperature measure mode. Connect the K-type thermocouple sensor to COM and V terminal and read the displayed value.

#### 4.10. DIODE TEST

Use the FUNC. Key to select Diode ➔ measure mode. Connect the black and red test leads plug to the COM and V terminal. Connect the test leads probe to the target. Red test lead connection will be positive. The meter will show the approx. forward voltage of the diode. **DO NOT** input a voltage source at this mode.

#### 4.11. LIVE TEST (ONLY ONE RED TEST LEAD PLUG IN)

Hold the meter by hand. Hold the FUNC. Key for 3 seconds, then press FUNC. Key once to select LIVE test function. Connect the red test lead plug to the V terminal. (Only need one RED test lead). Connect the red test leads to the circuit being measured. "Hi" will be shown when connect the red test leads to LIVE wire.

#### 4.12. NON-CONTACT VOLTAGE DETECT (NCV/EF) TEST

Hold the FUNC. Key for 3 seconds to select NCV function. Make upper right corner of device (marking NCV) close to test wire/socket. It will showing 4 bars according LIVE voltage level and distance.

#### 4.13. HOLD KEY / BACKLIGHT KEY

Press once for Data Hold function. This will stop the meter from updating the display. Hold for 3 seconds for backlight and flashlight on/off.

#### 4.14. FUNC KEY / RANGE KEY

Press once to switch between SCAN function, DCV, ACV, Resistance, Continuity, Diode, Capacitance, Frequency, Temperature. Hold for 3 seconds for Into/Exit EF/LIVE test mode

#### 4.15. AUTO POWER OFF FUNCTION

The Meter enters "sleep mode" if the Meter is on but not used for 30 minutes. Hold for 5 seconds "HOLD" key then Press "ON/OFF" key to turn on meter, meter will disable auto power off function, auto power off symbol will disappear.

#### 4.16. CURRENT PLUG-IN DETECT

When a test lead is plugged in at the mA/A terminal, then any measurement function will be changed to current measurement function.

#### 4.17. VOLTAGE ALARM

A lightning symbol ⚡ will be displayed if the device is receiving a hazardous voltage >36V.



## 5. MAINTENANCE

❑ **WARNING!** Ensure test leads have been disconnected before opening the casing. Close and secure casing before reuse.

#### 5.1. BATTERY REPLACEMENT (FIG.2)

If the battery symbol 🔋 appears on the LCD display, the battery should be replaced. Remove the screw on the back cover and open the battery case. Replace the exhausted batteries with two new 1.5V batteries of the same type (AAA). Close and secure casing before reuse.

#### 5.2. FUSE REPLACEMENT

The fuse rarely needs replacement. A blown fuse is normally a result of the operator's error. Open the case and replace the blown fuse with the same rating specified: F 10A/600V Ø6x30. Close and secure casing before reuse.

#### 5.3. PROBE / TEST LEAD REPLACEMENT

**DO NOT** use if the probe, test leads or wires are damaged. **DO NOT** repair. Use suitable replacement parts only.

#### 5.4. CLEANING AND DECONTAMINATION INSTRUCTIONS

✘ **DO NOT** use abrasives or solvents on the meter. Clean it only with a damp cloth and mild detergent.



#### ENVIRONMENT PROTECTION

Recycle unwanted materials instead of disposing of them as waste. All tools, accessories and packaging should be sorted, taken to a recycling centre and disposed of in a manner which is compatible with the environment. When the product becomes completely unserviceable and requires disposal, drain any fluids (if applicable) into approved containers and dispose of the product and fluids according to local regulations.



REGISTER YOUR  
PURCHASE HERE



#### WEEE REGULATIONS

Dispose of this product at the end of its working life in compliance with the EU Directive on Waste Electrical and Electronic Equipment (WEEE). When the product is no longer required, it must be disposed of in an environmentally protective way. Contact your local solid waste authority for recycling information.



#### BATTERY REMOVAL

Under the Waste Batteries and Accumulators Regulations 2009, Jack Sealey Ltd are required to inform potential purchasers of products containing batteries (as defined within these regulations), that they are registered with Valpak's registered compliance scheme. Jack Sealey Ltd Batteries Producer Registration Number (BPRN) is BPRN00705.

**Note:** It is our policy to continually improve products and as such we reserve the right to alter data, specifications and component parts without prior notice.

**Important:** No Liability is accepted for incorrect use of this product.

**Warranty:** Guarantee is 12 months from purchase date, proof of which is required for any claim.

Jack Sealey Ltd t/a Sealey Group, Kempson Way, Suffolk Business Park, Bury St Edmunds, Suffolk, IP32 7AR UK

Jack Sealey (EU) Ltd t/a Sealey Group, Farney Street, Carrickmacross, Co. Monaghan, A81 PK68 Ireland

Tel: 01284 757500 • Email: sales@sealey.co.uk • Web: www.sealey.co.uk